Service Bulletin

SB No. LCD04092901R2

Original Date	Revision Date	Distribution	STATUS	Author
MAY 03, 2004	SEP 29, 2004	Domestic and International	Revision	Rob Short

Subject: LCD Entertainment Screen Blank
Serial Number: ALL

Time Required: ☒15 min ☐30 min ☐45 min ☐1 hr +

Distribute To: ☐Internal ☒Dealer ☒ISO ☐Customer

DESCRIPTION:
Console Screen is blank. There is sound with headphones plugged in.

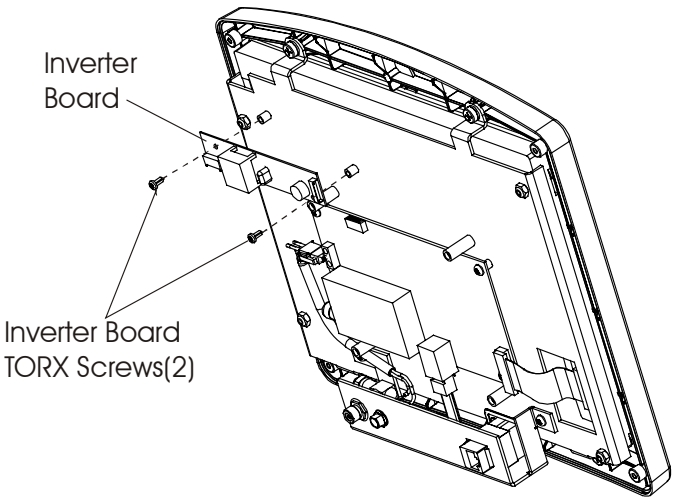

SOLUTION:
Replace Inverter Board with Part No. GK32-00002-0004.

The following procedure can be used to replace the Inverter Board.

Caution: To avoid electrostatic damage to the circuitry system, you must wear an anti-static wrist strap and ground yourself to the unit before attempting to replace the Inverter Board.

1. Remove the TV Assembly.
2. Remove four screws securing the Back Cover of the TV Console, and then separate the two console halves.
3. Lift off back the Protective Cover exposing the Inverter Board, and then unplug the three cables. Discard the inverter board.

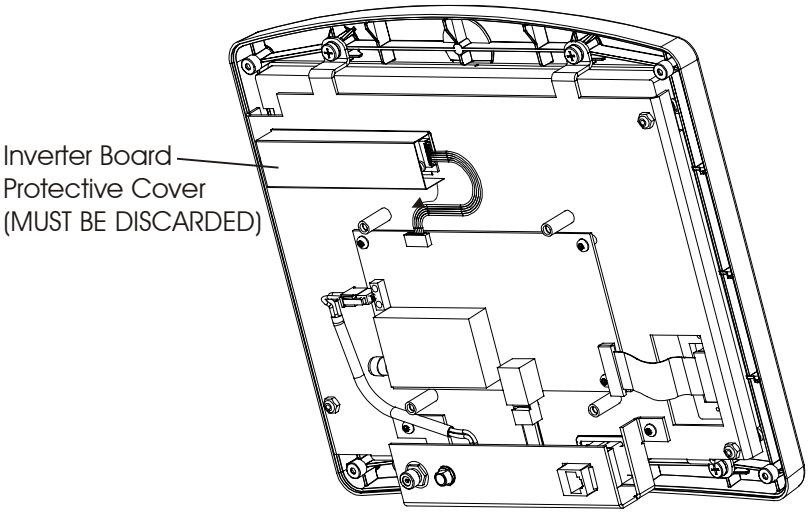

PROBLEM CODE:
FINV

TYPE CODE:
WARR

Life Fitness Proprietary and Confidential Information - Only for the Use of the Intended Recipient - Do Not Reproduce or Distribute.

Replace Inverter Board - Continued:

4. Remove two Torx Screws securing the Inverter Board from the PC board.

5. Remove the Inverter Board.

Note: Discard Protective Cover if present.

6. Install new Inverter Board with Part No. GK32-00002-0004.

7. Check for power.

Note: Make sure to discard the Inverter Board Protective Cover.

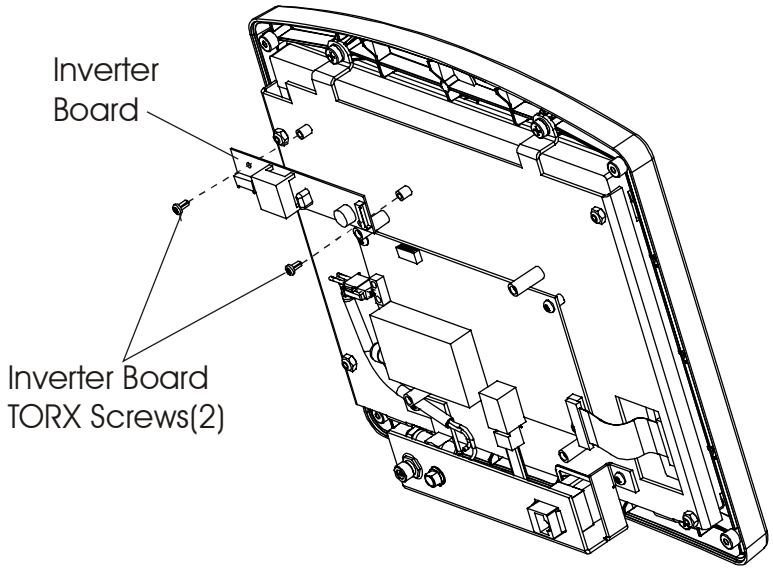

PROBLEM CODE:
FINV

TYPE CODE:
WARR

Life Fitness Proprietary and Confidential Information - Only for the Use of the Intended Recipient - Do Not Reproduce or Distribute.